Vernon Trail NLT-0208

65 South Street Vernon, Indiana 47282


Date Wed 12/11/2024

Job#

Prepared By Bradley Bender





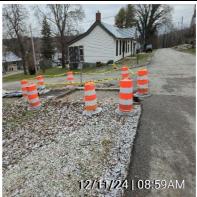



Work Logs		No entry
Name Description	Quantity	Total Hours
Total	0	0

General Notes

1. 8.30am

Reviewed pike and Montgomery ramps with concrete crew. Panels to be parallel to and have 6 inch ribbon border off edge of pavement, and 8 foot width. Accepted leaving a 6 inch ribbon border on the outside of the panel, where contractor formed out to 9 feet, where 2 to 4 inch listed in standard sheets.

North side pike transition slope at 14%, to 7% at center, flat. Existing conditions and shared path use affect this location.

Approved no joints for panels, and tooled joints rather than sawn.

9.15am

Excavation crew moved to clearing between gym and new restroom. No tunnel found, but pvc sanitary very limited cover is above existing piping to gym, and hole at gym not grouted. Stone for trail to be placed for later compaction.

Noon

Spoke to David Boswell, clear to continue with all the concrete work, restroom foundation to begin early next week.

12.30pm

Excavation crew installing water service to restroom and layed out for ramps, crossing, stand alone slab and need to email FPBH with gate questions.

Need to email matt owens with questions on restroom finish floor and sanitary service cover questions.

Site Safety Observations

No entry

Quality Control Observations

No entry

Survey		
Questions	N/A No Yes Description	
1. Any accidents on site today?		
2. Any schedule delays occur?		
3. Did weather cause any delays?		
4. Any visitors on site?		
5. Any areas that can't be worked on?		
6. Any equipment rented on site?		

Attachments



















BABL

I, Bradley Bender, have reviewed and completed this report.

Bradley Bender | 12/13/24 | 08:30AM